

Base Mounting Support ▶ Open Type · Open Economic Type



Please order according to the diagram

①~④ Select the type and parameters in the order for ordering.

■ Open Type

Model(①Code) — ②DH7
KTCCQ — D10

■ Open Economic Type

Model(①Code) — ②DH7
KTDCV — D10




● Discounted Price
Quantity 1~9 10~
Price 100% Separate Quotation
Price Excluding Tax (Vat)

Mounting Parts
Base · Post Clamps
31



■ Open Type



CAD 2D

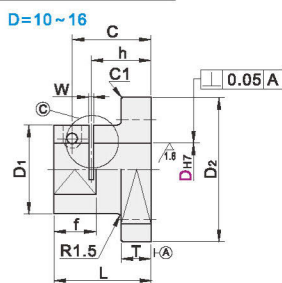

D=20~50

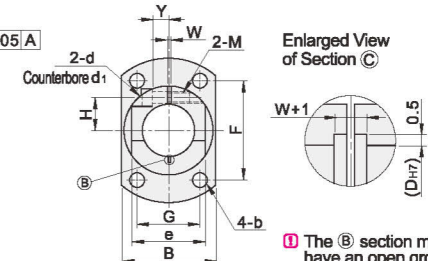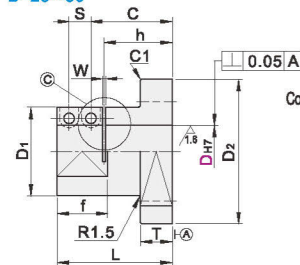

① The B section may have an open groove.


① For rust prevention requirements, stainless steel or electroless nickel plated products are preferred.

Code	Model	DH7	D2	B	L	T	D1	F	G	b	C	S	H	Y	d	d1	M	h	f	e	W
KTCCQ KTCCR KTCCU KTCCS	10	+0.015 0	50	33	35	10	30	35	18	4.5	29	—	9	5	4.5	8	M4	22	15	20	22
	12	+0.018 0	52	35	—	—	32	37	20	—	—	—	11.5	—	—	—	—	—	—	—	—
	15	+0.018 0	58	40	39	—	35	40	24	5.5	32	—	12	6	5.5	10	M5	24	17	25	—
	16	+0.021 0	73	45	50	12	40	50	28	6.6	33.8	10.5	14.5	7	6.6	11	M6	34	28	35	2
	25	+0.021 0	93	55	60	—	50	62	36	g	41.5	12	18.5	—	—	—	—	—	—	—	—
	30	+0.025 0	103	65	70	—	60	72	42	—	47	15	21.5	10	—	—	—	—	—	—	—
	35	+0.025 0	108	70	80	15	65	75	45	11	55	17	24.5	—	9	14	M8	44	39	50	—
	40	+0.025 0	118	75	90	—	70	78	55	—	64	17	26.5	13	—	—	—	—	—	—	—
	50	+0.025 0	138	90	110	18	85	95	60	14	77.5	21.5	32.5	16	11	17.5	M10	65	48	70	3




■ Open Economic Type



CAD 2D

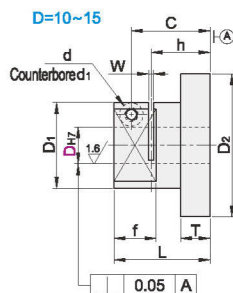

D=20~50

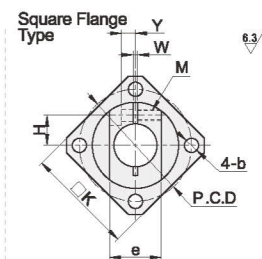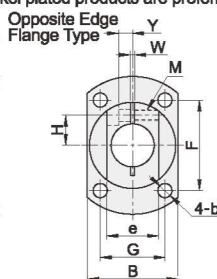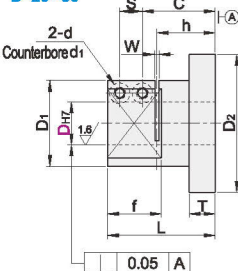

① For rust prevention requirements, stainless steel or electroless nickel plated products are preferred.

Model		D ₂	B	L	T	D ₁	F	G	b	C	S	H	Y	W	d	d ₁	M	h	f	e	K	P.C.D	
Code	D _{H7}																						
Opposite Edge Flange Type	10	+0.015 0	45	27	35	10	26	30	18			9.5	3							14	35	36	
	12	+0.018 0	50	31	39	10	30	34	22	4.5	29	—	10.5	3.5		4.5	8	M4	22	15	16	38	40
	15		58	37	39		35	38	26	5.5	32		12.5	4					24	17	19	44	46
	20		64	41	50	12	40	42	30	6.6	33.8	10.5	14	6.5	2	5.5	9.5	M5	27	25	24	50	52
	25	+0.021 0	80	49	60		48	54	35		41.5	12	17			6.6	11	M6	34	28	29	62	64
Square Flange Type	30		90	59	70		58	58	45	9	47	15	21	8					38	34	34	68	74
	35		100	65	80	15	64	66	48		55	16	23			9	14	M8	44	39	41	76	82
	40	+0.025 0	106	71	90		70	70	54	11	64	17	26	11.5	3				53	40	46	80	88
	50		125	87	110	18	85	80	68	14	77.5	21	32	12		11	17.5	M10	65	48	58	94	105

① DH7 tolerance and perpendicularity are tolerances before opening.

① The recommended tolerances for mating shafts are g6 and f8.